



<b>Subject:</b> <b>BLIND SPOT MONITORING (BSM) DOES NOT OPERATE AFTER REPAIR</b>	<b>Service Alert No.:</b> SA-013/18
	<b>Last Issued:</b> 06/06/2018

## BULLETIN NOTES

This Service Alert supersedes the previously issued Service Alert(s) listed below: The changes are noted in Red.

Previously issued Service Alert(s)	Date(s) issued:
SA-013/18	03/06/18

## APPLICABLE MODEL(S)/VINS

2017-2018 CX-5

## DESCRIPTION

Some customer's may complain that the blind spot monitoring (BSM) is not operating, and the key ON bulb check is OK with no DTCs stored in memory. This issue could be caused by mis-matched BSM modules, especially if the vehicle was recently involved in an accident or work was done on the BSM system. To check if this is the issue, refer to the Repair Procedure.

## REPAIR PROCEDURE

1. Remove the rear bumper according to the instruction on MGSS (REAR BUMPER REMOVAL/INSTALLATION).


2. Inspect the labels (1) on the BSM modules:

- If both modules have part numbers that are KB8C-67Y30E (suffix E) or lower, proceed to next step.
- If any module has a part number that is KB8C-67Y30F (suffix F) or later, this service information does not apply. Suffix F or later mismatch is OK.

3. Inspect the labels (2) on the BSM modules (P/N KB8C-67Y30E).

- If one module has 2 digit alphanumeric label with "A8" and the other has label "A9", replace the "A9" module with an "A8" module (if the P/N is KB8C-67Y30E) or with P/N KB8C-67Y30F (suffix F) or later. "A9" modules have been quarantined and only KB8C-67Y30F (suffix F) or later modules are available from Parts Inventory.
- If both modules have the same 2 digit alphanumeric label (both have "A8" or "A9" labels), this is not the issue. Refer to BSM troubleshooting procedures on MGSS.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

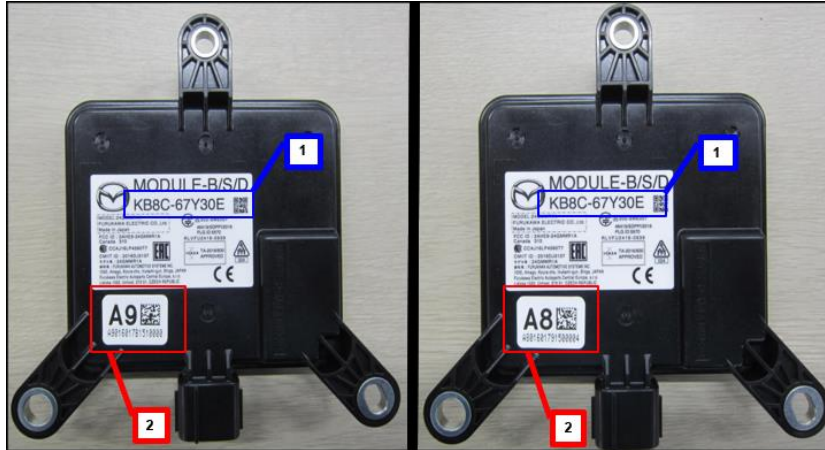

4. Install the rear bumper after troubleshooting is complete.

## WARRANTY INFORMATION

Use the applicable Warranty Wizard labor operation and the time for the side/vehicle as necessary.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.